

Date: Thursday, 7/19/2007 2:20:44 PM
 User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: FWD TUBE ASSEMBLY
Job Number	: 33631		
Estimate Number	: 10467		
P.O. Number	: <i>N/A</i>	Part Number	: D3391021
This Issue	: 7/19/2007	S.O. No.	: <i>N/A</i>
Prsht Rev.	: NC	Drawing Number	: D3391 REV.F
First Issue	: <i>NA</i>	Project Number	: N/A
Previous Run	: 33630	Drawing Revision	: F
		Material	: <i>N/A</i>
Written By	: <i>JA</i>	Due Date	: 7/30/2007
Checked & Approved By	: <i>JA 07.07.19</i>	Qty:	1 Um: Each
Comment	Est. A 05.09.13 New issue KJ/JLM Est. B 06.02.10 Dwg rev.D ecn 773 EC Est. C 06.05.02 Added inspections EC est D 07.03.13 rev F dwg EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	D6013047	SKIDTUBE MAT'L
-----	----------	----------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
 SKIDTUBE MAT'L

Pick:

Qty	Part Number	Description	Batch
1	D6013-047	Extrusion	<i>B26547 DP 7-7-25</i>

2.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1
 Cut extrusion to 46.52 +0.010 -0.020

DP 7-7-25

3.0	BENDING	BENDING MACHINE
-----	---------	-----------------



Comment: No bender
 Bend as per Dwg D3391 Using Bend Prog 3391021

FL 7-10-31

4.0	QC5	INSPECT WORK TO CURRENT STEP
-----	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

6 7/16/02

5.0	HAAS1	HAAS CNC VERTICAL MACHINING #1
-----	-------	--------------------------------



Comment: HAAS CNC VERTICAL MACHINING #1
 1-Machine as per Folio FA590 Rev. *F* & Dwg D3391 Rev. *F*
 Identify as D3391-1

2-Deburr

JA 07.11.04

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:20:44 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 33631

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description:

6.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

SA 07.11.04

7.0

MILLING CONV.

CONVENTIONAL MILLING MACHINE



Comment: CONVENTIONAL MILLING MACHINE
Drill X1 Aft cap as per Dwg D3391

SA 07-11-04 ①

8.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

SA 07-11-04

9.0

QC8

SECOND CHECK



Comment: SECOND CHECK

SL 07/11/05

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill and c/sink float bag holes as per Dwg D3391 using DT8798(Do not open tow cap holes to finish size)
(ONLY DRILL HOLES MARKED "A")

2-Drill Remaining two holes for tow cap using DT 8819 Locating off of .1875" holes drilled in previous step

3-Open tow cap holes to .208" as per Dwg D3391

4-Open Tow Ring hole to .640" as per Dwg D3391

5-Deburr & Scribe Batch number Inside aft end.

DD
7-11-15

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

SA 07-11-15 ①

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

SL 7-11-15

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:20:44 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 33631

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



(1X)

Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

M.H. 07/11/15

14.0

POWDER COATING

POWDER COATING



(1X)

Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M.H. 07/11/15

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL 07/11/16 (1)

16.0

NAS1330C3KB166

INSERT



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Rivnut

Pick:

Qty

Part Number

Description

Batch

14

NAS1330C3KB166

Insert

m106192.

FL

17.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install Inserts as per Dwg

FL 07/11/16 (1)

18.0

QC5

INSPECT WORK TO CURRENT STEP



(1)

Comment: INSPECT WORK TO CURRENT STEP

ml 07/11/16

19.0

D3401041

Tow Cap Assembly



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Tow Cap Assembly

Pick:

Qty

Part Number

Description

Batch

1

D3401-041

Tow Cap

D31336

FL 07/11/16 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action-Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:20:44 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 33631

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

D356413

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
WEARSHOE

633867

Fd

21.0

D356613

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
GASKET

632744

Fd

22.0

AN3C4A

BOLT



Comment: Qty.: 10.0000 Each(s)/Unit Total: 10.0000 Each(s)
Bolt
Pick:
Qty Part Number Description Batch
4 AN3C4A Bolt

M106043

Fd

23.0

NAS1515H3L

WASHER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)
Washer
Pick:
Qty Part Number Description Batch
4 NAS1515H3L Washer

M105116

Fd

24.0

AN960C10L

washer



Comment: Qty.: 10.0000 Each(s)/Unit Total: 10.0000 Each(s)
washer

M106167

Fd

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: SMALL & MEDIUM FAB RESOURCE 1
Install tow Cap as per Dwg D3391
Identify as D3391-021

Fd 07/11/16

26.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP
Inspect thread of each insert using DT8821

M 07 11 16

(1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: PD Date: 01/11/19
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:20:44 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 33631

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

27.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: _____

35950

28.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

①
DCA 11/17

Job Completion



U 07.11.17


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

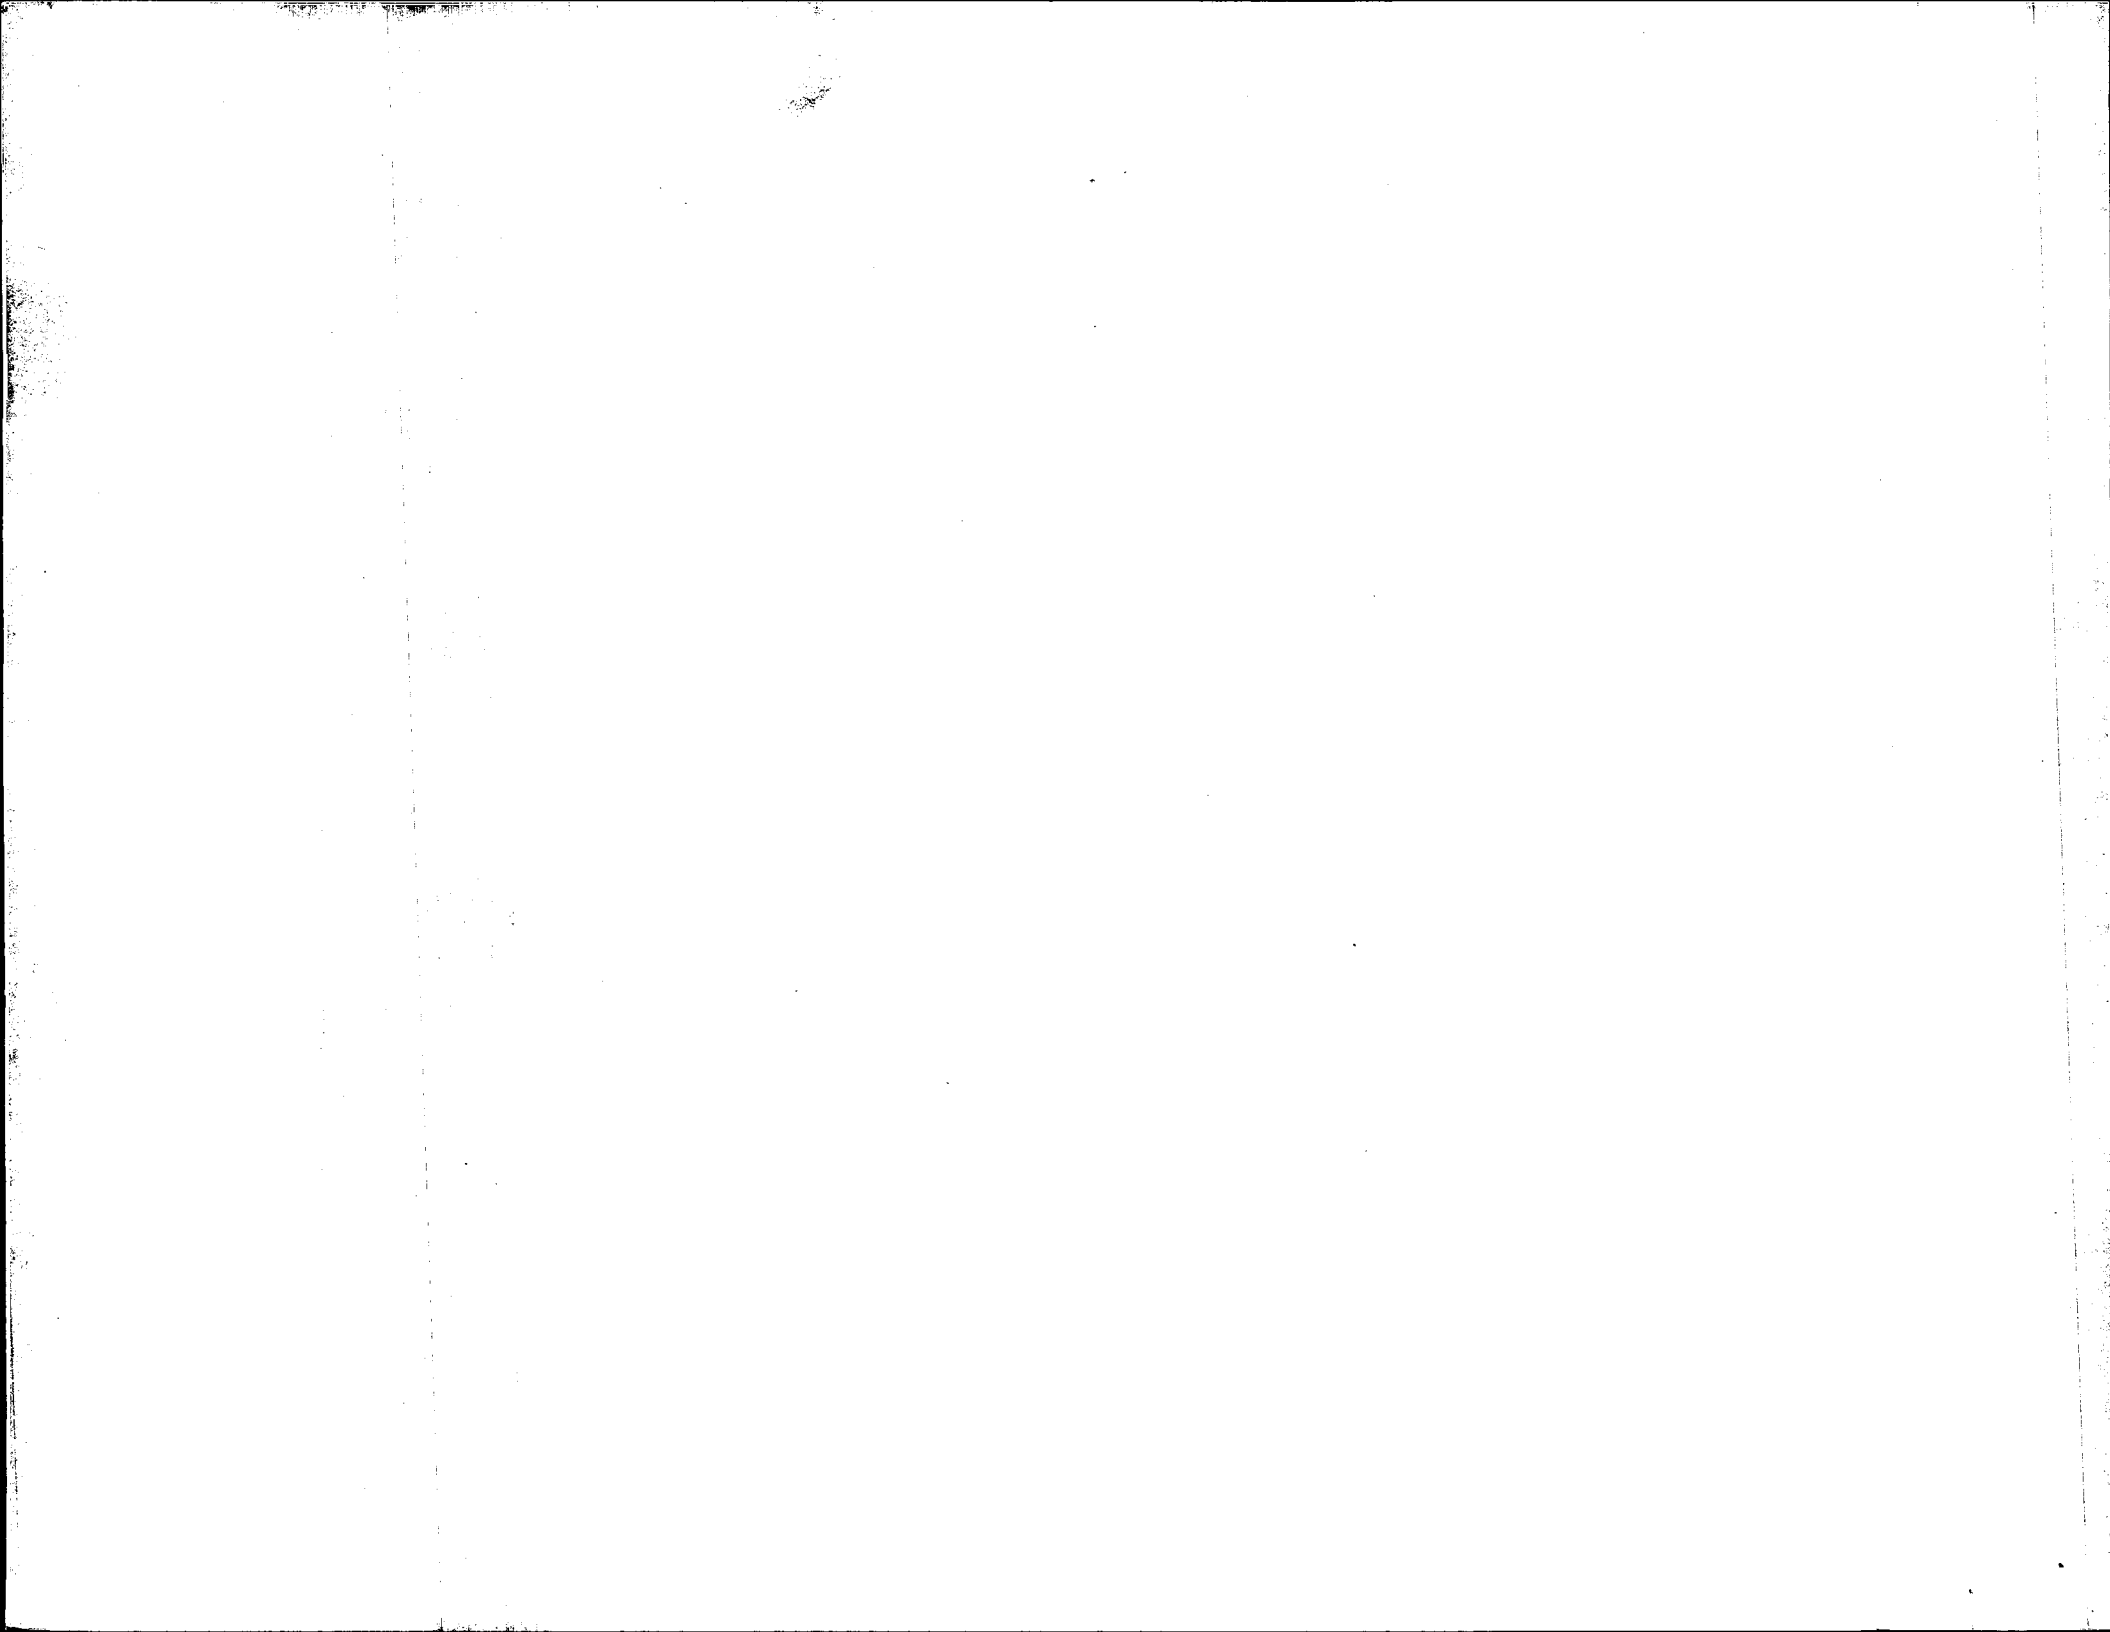

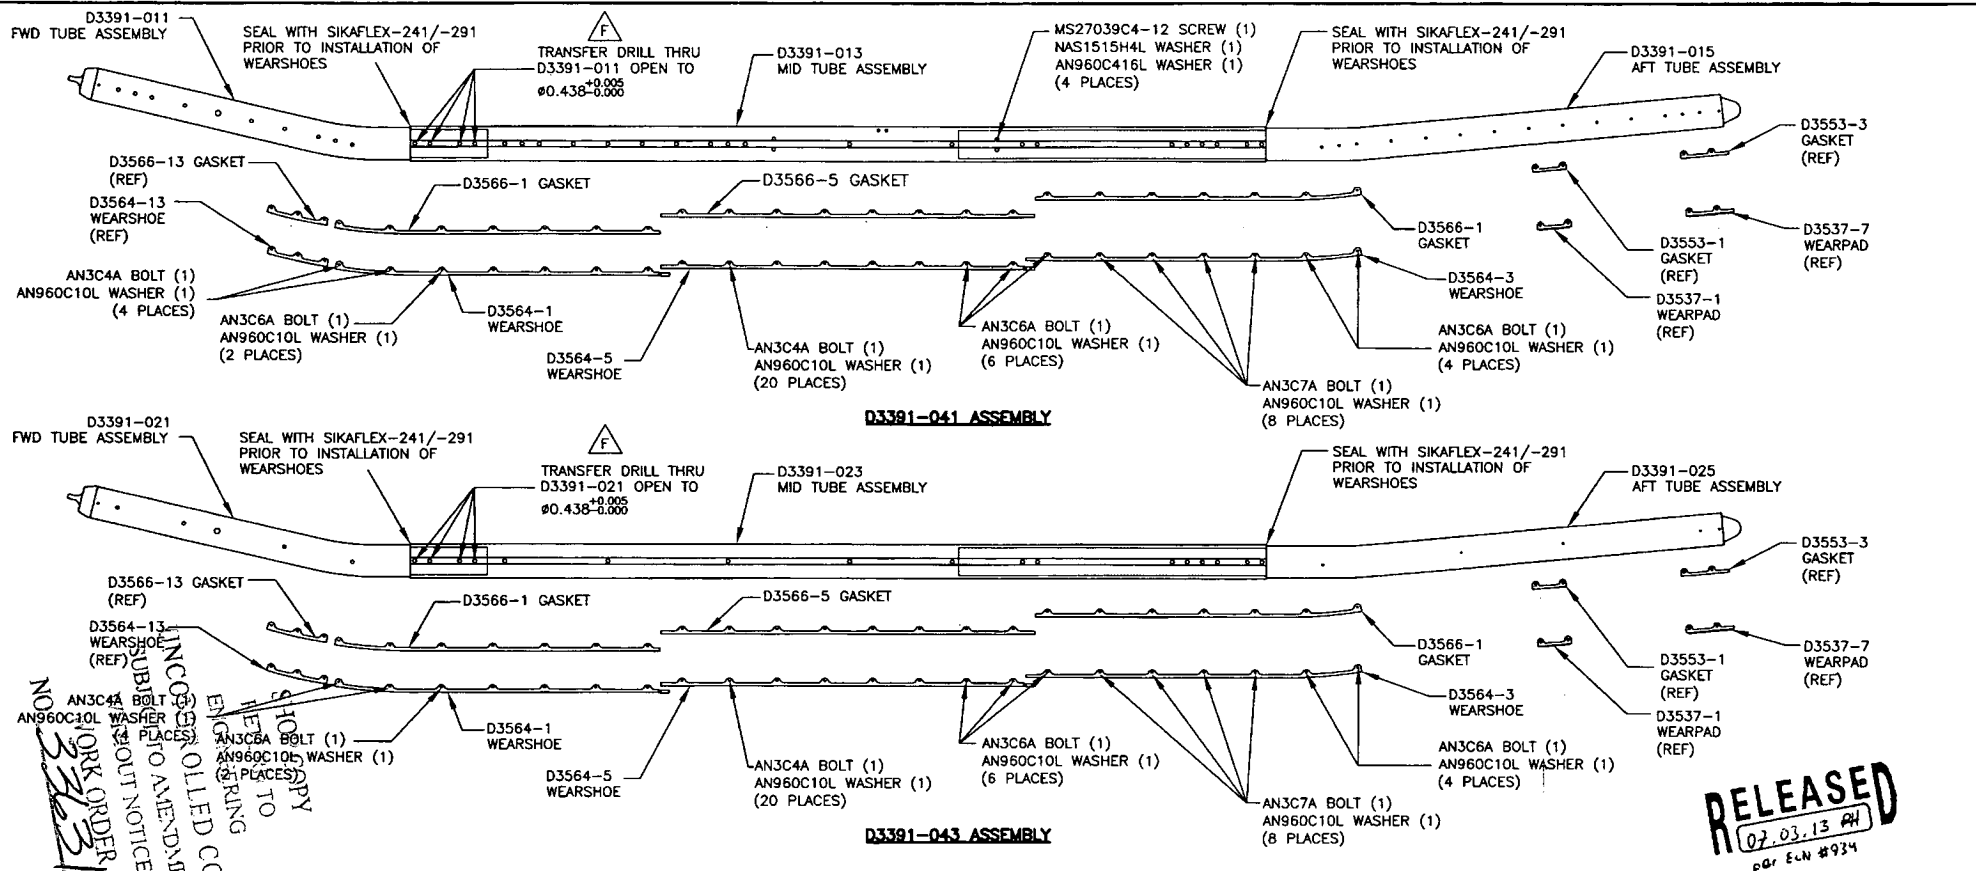

D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	QTY	PART NUMBER	DESCRIPTION
X	X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
		D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
1	1	D3391-021	FWD TUBE ASSEMBLY
1	1	D3391-023	MID TUBE ASSEMBLY
1	1	D3391-025	AFT TUBE ASSEMBLY
1	1	D3564-1	WEARSHOE
1	1	D3564-3	WEARSHOE
1	1	D3564-5	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
24	24	AN3C6A	BOLT
12	12	AN3C6A	BOLT
8	8	AN3C7A	BOLT
44	44	AN960C10L	WASHER
4	4	MS27039C4-12	SCREW
4	4	NAS1515H4L	WASHER
4	4	AN960C416L	WASHER

GENERAL NOTES

- ALL DIMENSIONS ARE IN INCHES
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- FINISH: ACID ETCH AND ALDINE PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL 'E' SIZE HOLES (Ø0.250-Ø0.257) FOR WEARSHOE INSERTS. C/SINK Ø0.391/Ø0.425 x 100' AS APPLICABLE AND INSTALL INSERTS EXCEPT WHERE INDICATED.


COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


F	07.01.18	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021
E	06.04.25	CHANGE TOLERANCE, EASE MANUFACTURE
D	06.01.23	UPDATE TOLERANCE, CHANGE HOLE SIZE
C	05.09.27	LENGTHEN AFT EXTENSION
B	05.06.10	DRAWING UPDATES
A	05.02.07	NEW ISSUE
DESIGN	PH	DRAWN BY
CHECKED	PH	APPROVED
DATE	07.01.18	TITLE
		412 FLOAT SKIDTUBE
		SCALE
		NTS

RELEASED
07.03.13 PH
per E-N #934


RELEASED
D7.03.13 AH

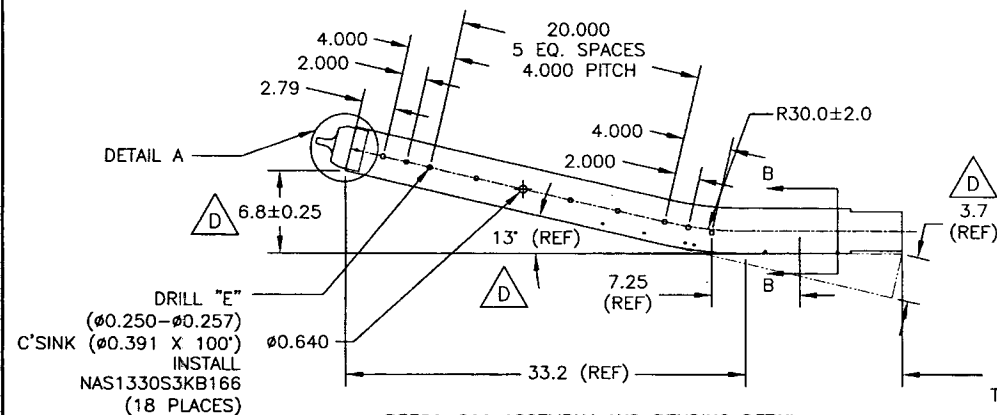

D3391-011 ASSEMBLY AND BENDING DETAIL

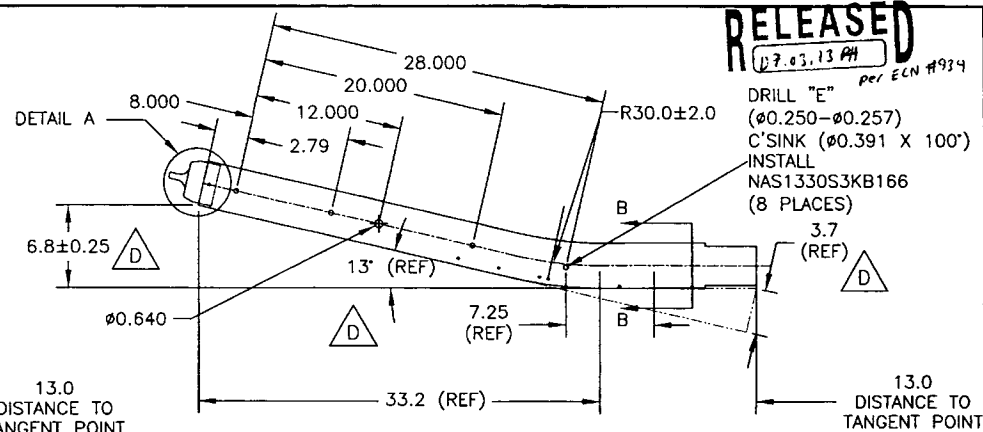


D3391-021 ASSEMBLY AND BENDING DETAIL

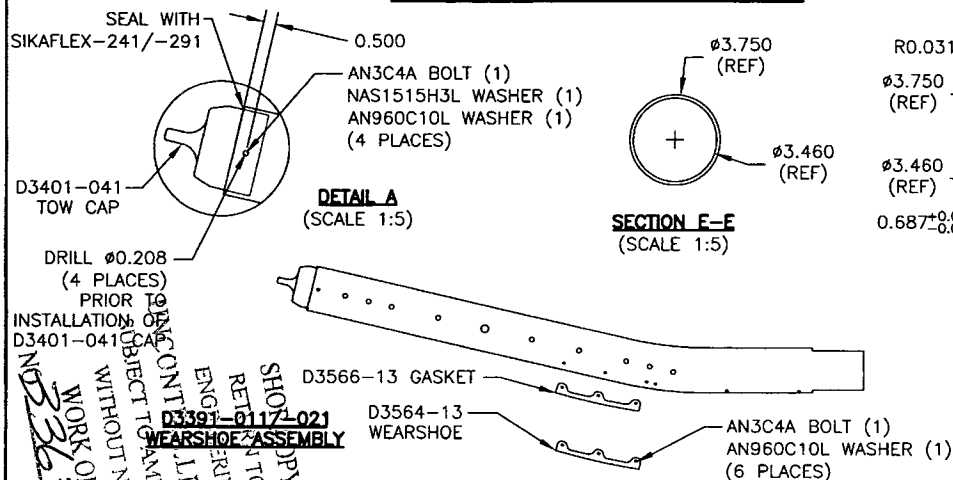


DETAIL A
(SCALE 1:5)


SECTION E-E
(SCALE 1:5)

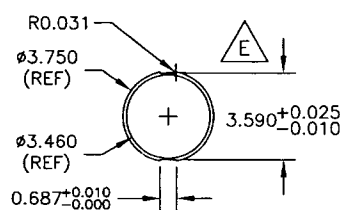


SECTION D-D
(SCALE 1:5)

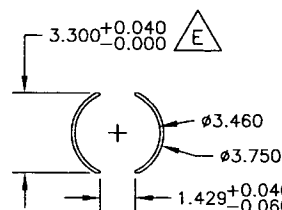

SECTION C-C
(SCALE 1:5)

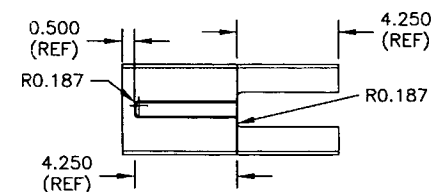

VIEW Z-Z
(SCALE 1:5)

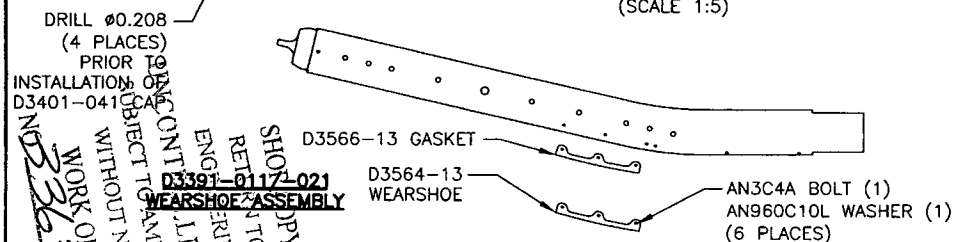


D3391-011-021 FWD TUBE ASSEMBLY PARTS LIST

QTY	QTY	PART NUMBER	DESCRIPTION
1	1	D3391-011	FWD TUBE ASSEMBLY
1	1	D3391-021	FWD TUBE ASSEMBLY
1	1	D6013-047	FWD TUBE
1	1	D3401-041	TOW CAP
1	1	D3564-13	WEARSHOE
1	1	D3566-13	GASKET
10	10	AN3C4A	BOLT
4	4	NAS1515H3L	WASHER
10	10	AN960C10L	WASHER
30	20	NAS1330S3KB166	INSERT (OR NAS1330C3KB166)

5
DRILL "E"
(Ø0.250-Ø0.257)
C'SINK (Ø0.391 X 100')
INSTALL
NAS1330S3KB166
(12 PLACES)

SECTION B-B
(SCALE 1:5)








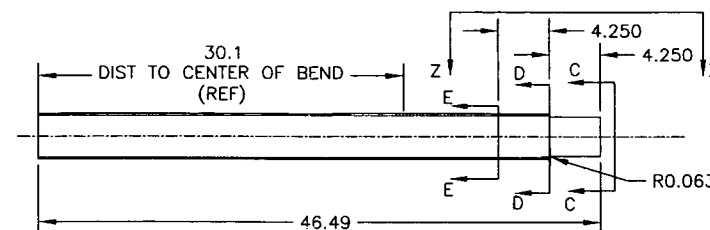


D3391-1 DRILLING AND CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.





THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	DRAWN BY	DART	DART AEROSPACE USA, INC.
PH	PH		PORT HADLOCK, MA
CHECKED	APPROVED	DRAWING NO.	REV. F
		D3391	SHEET 2 OF 5
DATE		TITLE	SCALE
07.01.18		412 FLOAT SKIDTUBE	1:10

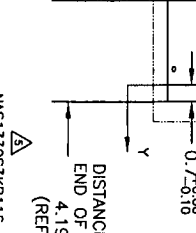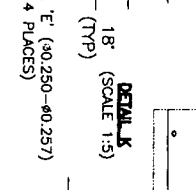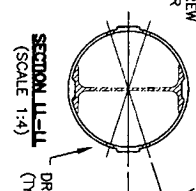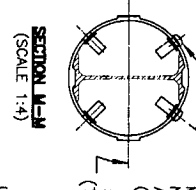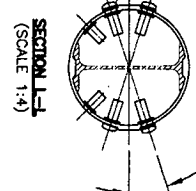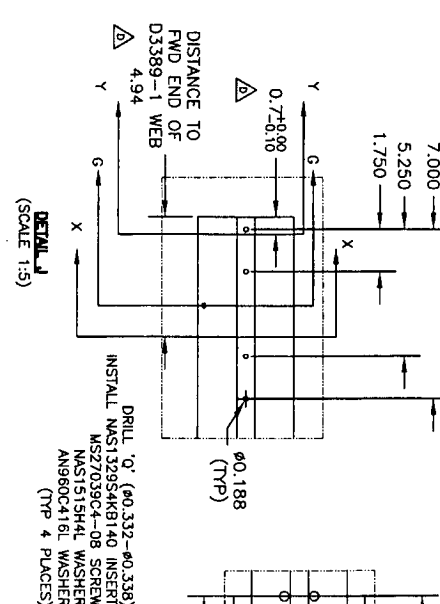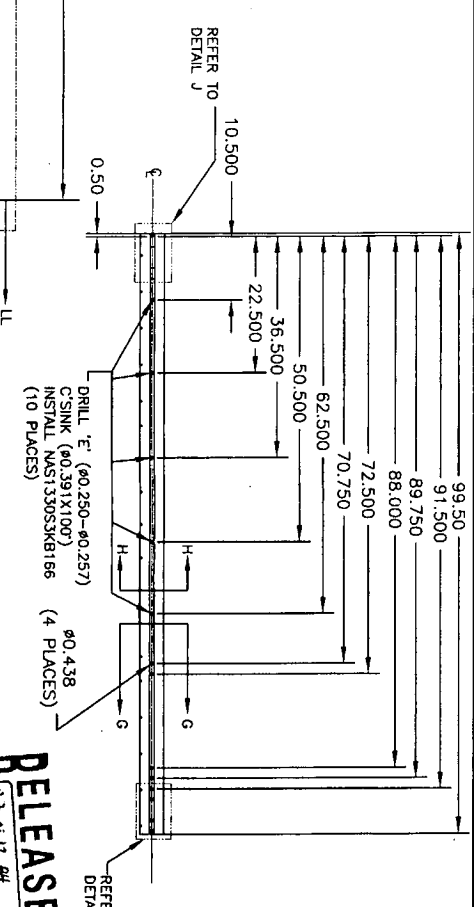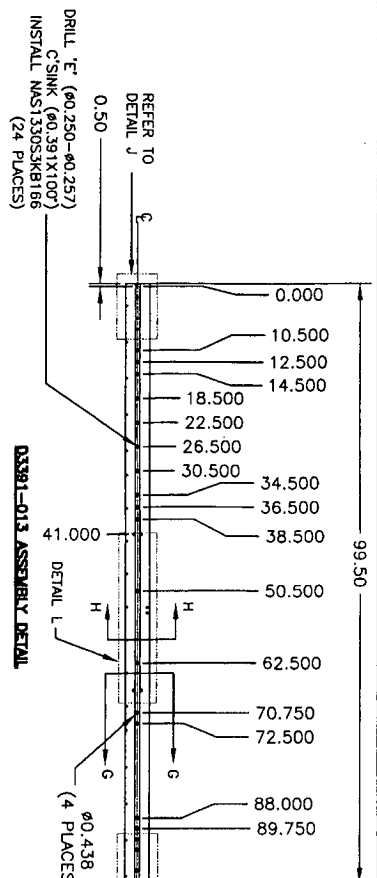

QTY - 013	QTY - 023	PART NUMBER	DESCRIPTION
X	X	D3391-013	MID TUBE ASSEMBLY
X	X	D3391-023	MID TUBE ASSEMBLY
1	1	D2500-1-100	EXTRUSION
1	1	D3389-1	WEB
24	20	NAS1330S3KB116	INSERT (OR NAS1330C3KB116)
24	10	NAS1330S3KB166	INSERT (OR NAS1330C3KB166)
4	4	NAS1329S4KB140	INSERT (OR NAS1329C3KB140)
4	4	NAS1515H4L	WASHER
4	4	AN960C10L	WASHER
4	4	AN960C416L	WASHER
4	4	MS27039C1-09	SCREW
4	4	MS27039C4-08	SCREW

D3391-013-023 MID TUBE ASSEMBLY
 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SHAFLEX-241/-291 PER D3391-013

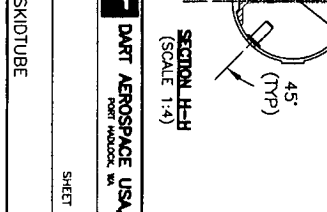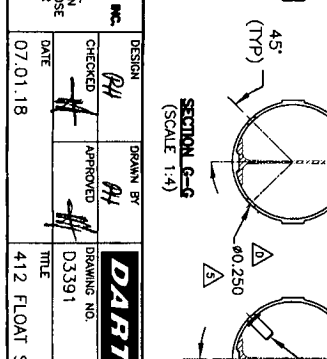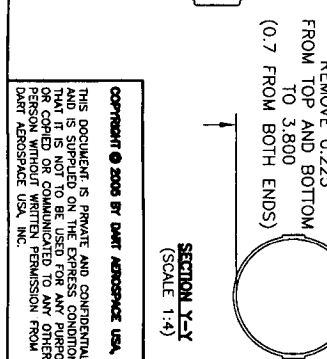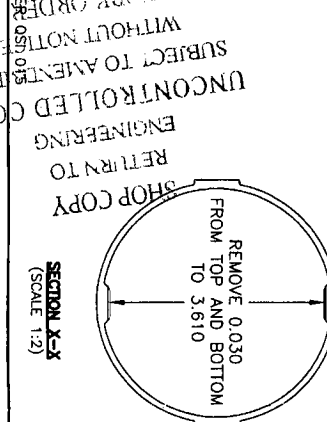

DESIGN **PH** **APPROVED** **PH** **DART** **DART AEROSPACE USA, INC.**


CHECKED **PH** **APPROVED** **PH** **DART** **DART AEROSPACE USA, INC.**

DATE 07.01.18 TITLE 412 FLOAT SKIDTUBE


REV. F SHEET 3 OF 5 SCALE 1:20

RELEASED
 07.01.18
 07.01.18


UNCONTROLLED COPY
 SUBJECT TO AGENCY REVIEW
 WITHOUT NOTIFICATION

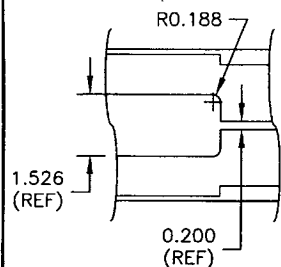


VIEW BB-BB
(SCALE 1:3)

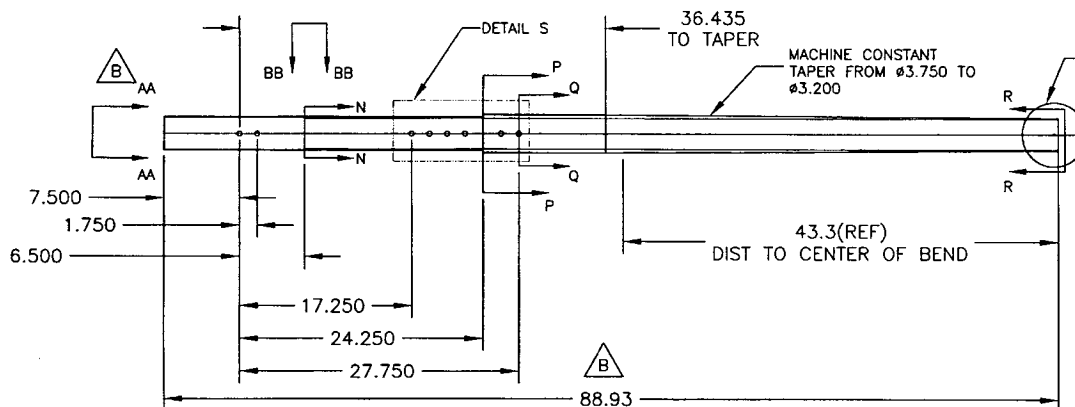


D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

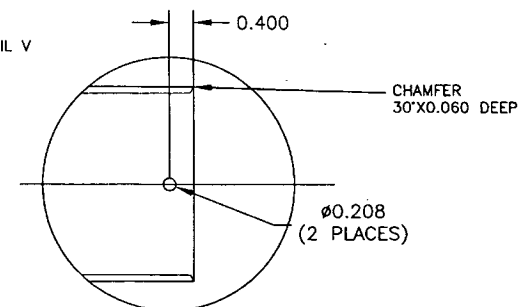


DETAIL V
(SCALE 1:2)

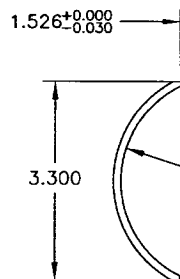


SECTION AA-AA
(SCALE 1:2)

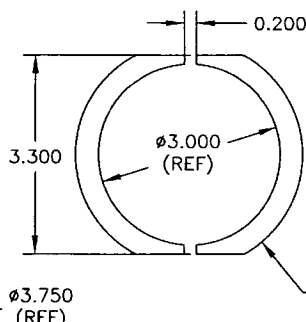


SECTION N-N
(SCALE 1:2)

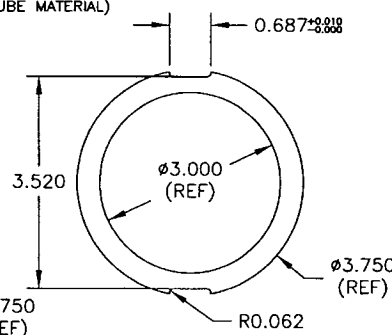

SECTION P-P
(SCALE 1:2)

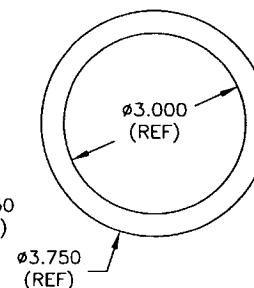


SECTION Q-Q
(SCALE 1:2)

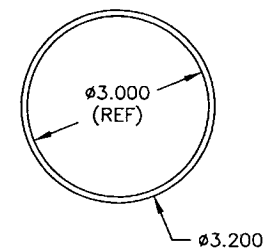


SECTION R-R
(SCALE 1:2)

NO WORK ORDER
3/26/03
SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

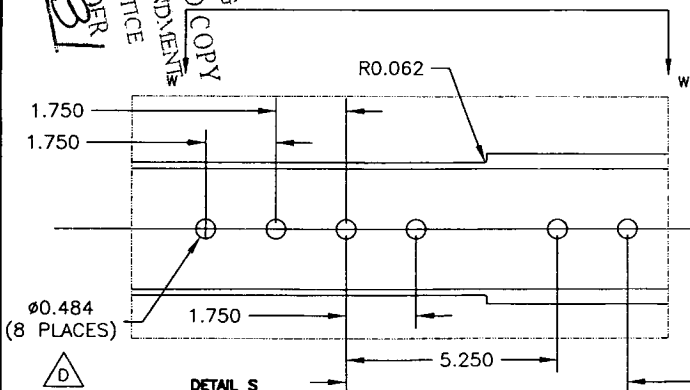

DETAIL S
(SCALE 1:3)

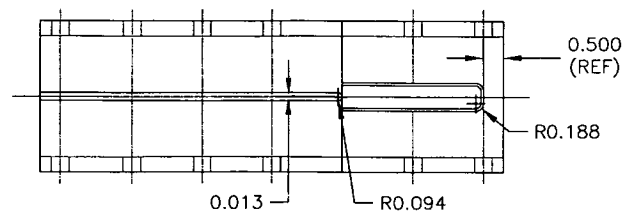

VIEW W-W
(SCALE 1:3)

RELEASED
07.03.13 PH
per ESN #934

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN PH	DRAWN BY PH	DART DART AEROSPACE USA, INC. FORT HADLOCK, MA	REV. F
CHECKED H	APPROVED H	DRAWING NO. D3391	SHEET 4 OF 5
DATE 07.01.18	TITLE 412 FLOAT SKIDTUBE	SCALE 1:12	



 DART AEROSPACE USA, INC. PORT HADLOCK, MA	
DRAWING NO. D3391	REV. F SHEET 5 OF 5
TITLE 412 FLOAT SKIDTIRED	SCALE 1:1

RELEASED
07.03.13 RH
ECN #934